

CONTENTS:

Pos	Name:	Art no:	Pcs
1	Sunvisor 35 cm 7 for all Scania NG Sunvisor 35 cm 9 for all Scania NG Sunvisor 35 cm 11 for all Scania NG* Sunvisor 30 cm 7 for all Scania NG Sunvisor 30 cm 9 for all Scania NG* Sunvisor BOW 7 for all Scania NG Sunvisor BOW 9 for all Scania NG* Sunvisor FLAT 7 for all Scania NG Sunvisor FLAT 9 for all Scania NG*	1112 1114 1116 1122 1124 1132 1134 1142 1144	
2	Mirror extender 170 mm for 35 and BOW Mirror extender 140 mm for 30 and FLAT	1182 1183	1 1
3	Mounting kit for mirror extender (A) Hexagonal screw M8x25 mm (B) Spring washer M8	1100	1 2 2
4	Scania sunvisor kit prepared for position lights (C) Original Scania screw M8x60 (D) Spacer	1103	1 2 3

* Only fits Optoline NG+ lights

IMPORTANT!
All installations should be done by experienced mechanics/vehicle electricians. In the event of your own modifications or making holes in the product, the warranty expires. Always follow the truck manufacturer's bodywork instructions regarding drilling and wiring in the cab. The same applies to the dimensioning of cables and the connection of lighting.

TruckStyle Sweden AB does not take responsibility for any damage that occurs in the event of an incorrect installation.

1. Remove the upper part to reuse later. Disconnect the connector (4) between the cab and the front mirror (1) and remove the front mirror from the cab by removing 2 screws (2). Disconnect any contact piece for position lights between the cab and the sunvisor. Remove position light (3) with associated cabling from the sunvisor.

NOTE! Save the position lights and associated wiring that will be reused for the new sunvisor.

1. Position light with connector
2. Screw M8x60
3. Front mirror
4. Front mirror cable & connector

2. Remove the sunvisor from the cab by removing remaining 4 screws (1) & (2).

NOTE! A sunvisor with position lights mounted at the bottom, the middle 2 M8x30 screws must be discarded and replaced with the 2 M8x60 screws that come with the kit for position lights. This is because of the spacers required.

1. Screw M8x30
2. Screw M8x60

3. Place the mirror extender (1) on the front mirror with 2 screws (3) and spring washers (2).

1. Mirror extender
2. Spring washer M8
3. Hexagonal screw M8x25

4. If equipped with position lights, fasten wiring to the position lights in the new sunvisor and use pre-drilled holes for cable ties.

5. Mount the sunvisor and the extended front mirror with the 6 Scania original screws (1). Distribute the 3 spacers (3) evenly on the cab/sunvisors 3 mounting points. Use the original Scania screws M8x60 that comes with the kit in the middle mounting holes of the sunvisor.

IMPORTANT! To ensure the windscreen wipers are moving freely, the spacers (3) are needed for sunvisors with position lights at the bottom.

IMPORTANT! If other accessories (for example light boxes or light arcs) are to be mounted, but only use two of the sunvisor's attachment points, an equally thick spacer must be used in the positions not affected by the accessories. Be sure to make the spacer 80x50 mm x thickness of the accessory. The reason is to distribute the tension evenly. No gaps are allowed!

IMPORTANT! Tighten the screws by starting with the 2 middle screws and finally tightening the 4 outer ones.

6. Connect the front mirror's connector (3) to the cab's connector. Before putting back the original upper part, check the function of the front mirror and same for the position lights if equipped.

1. Position light
2. Position light connector
3. Front mirror connector

IMPORTANT! All cable entries in the cab must be sealed so that water cannot enter the cab.